

# Release Note TS 019.03

The following copyright notice protects this book under Copyright laws which prohibit such actions as, but not limited to, copying, distributing, modifying, and making derivative works.

Copyright © Bull SAS 2023

### **Trademarks and Acknowledgements**

We acknowledge the rights of the proprietors of the trademarks mentioned in this manual.

All brand names and software and hardware product names are subject to trademark and/or patent protection.

Quoting of brand and product names is for information purposes only and does not represent trademark and/or patent misuse.

[www.bull.com](http://www.bull.com)

*Atos, the Atos logo, Atos Consulting, Atos Worldgrid, Worldline, BlueKiwi, Bull, Canopy the Open Cloud Company, Yunano, Zero Email, Zero Email Certified and The Zero Email Company are registered trademarks of the Atos group. Atos reserves the right to modify this document at any time without notice. Some offerings or parts of offerings described in this document may not be available locally. Please contact your local Atos office for information regarding the offerings available in your country. This document does not represent a contractual commitment.  
© 2015 Atos  
Bull will not be liable for errors contained herein, or for incidental or consequential damages in connection with the use of this material.*

---

# Table of Contents

<b>Preface</b> .....	<b>iii</b>
<b>Chapter 1. Overview</b> .....	<b>1</b>
1.1 Operating Systems (OS) .....	1
1.1.1 Red Hat .....	1
1.1.2 VMware ESXi .....	1
1.1.3 Windows .....	1
1.2 New features and changes .....	2
<b>Chapter 2. Known issues and restrictions</b> .....	<b>3</b>
2.1 Platform issues .....	3
2.1.1 LDAP authentication .....	3
2.1.2 Date and time setting .....	3
2.1.3 BIOS firmware update .....	3
2.1.4 Configuring an IPv4 custom route .....	3
2.1.5 Switching from DHCP to static IP address .....	4
2.1.6 Missing static IP address .....	4
2.1.7 Failed memory module .....	4
2.1.8 Power consumption .....	4
2.2 Software restrictions and issues .....	5
2.2.1 Installing VMware ESXi using a PXE server .....	5
2.2.2 Hanged BIOS boot .....	5
<b>Chapter 3. Recommendations</b> .....	<b>7</b>
3.1 Technical State (TS) numbering .....	7
3.2 Updating the system globally to a Technical State (TS) .....	8
3.3 Machine Intelligence System Management (MISM) .....	8
3.3.1 Zabbix version compatibility .....	8
3.3.2 Installing/Updating MISM .....	8
3.3.3 Updating firmware from a Technical State (TS) with MISM .....	8
3.3.4 MISM Light .....	8
3.4 Debugging the system .....	9
<b>Chapter 4. Information</b> .....	<b>13</b>
4.1 Baseboard Management Controller (BMC) user accounts .....	13
4.1.1 First connection to the BMC after the TS update .....	13
4.1.2 First connection to the BMC after a reset to default settings .....	14
<b>Chapter 5. Delivery contents</b> .....	<b>15</b>
5.1 Delivered items .....	15
5.2 Documentation .....	15

5.3	Platform firmware.....	15
5.4	Administration tools.....	16
<b>Chapter 6.</b>	<b>History of previous versions.....</b>	<b>17</b>
6.1	TS 019.02 (July 2022).....	17
6.2	TS 018.03 (February 2022).....	18
6.3	TS 018.02 (November 2021).....	19
6.4	TS 017.02 (June 2021).....	20
6.5	TS 016.02 (January 2022).....	21
6.6	TS 015.02 (August 2020).....	22
6.7	TS 014.01 (May 2020).....	23
6.8	TS 006.02 (December 2019).....	24
6.9	TS 005.01 (September 2019).....	25
6.10	TS 004.01 (June 2019).....	26

---

## Preface

This document gives information about all changes from the previous version.

It also gives information about restrictions, known problems and the associated workarounds.

Finally, it lists the objects delivered in the Technical State and the features of the resources provided on the Resource and Documentation DVD.

---

**See** The Bull Support Web site for the most up-to-date product information, documentation, firmware updates, software fixes and service offers:  
<http://support.bull.com>

---



---

# Chapter 1. Overview

## 1.1 Operating Systems (OS)

The following versions are supported for BullSequana Edge servers.

### 1.1.1 Red Hat

- RHEL 7.6
- RHEL 8

---

**Note** RHEL 8.3 does not support the NVIDIA A2 GPU. Update to RHEL 8.5 to use this model of GPU.

---

### 1.1.2 VMware ESXi

- ESXi 6.5u2 and higher
- ESXi 7.0u1

For certification details, check the [VMware Compatibility guide](#).

### 1.1.3 Windows

---

**Note** There is no Windows driver available for the WiFi PCIe card.

---

Windows Server 2019

Discrete Device Assignment of the GPUs is supported. For more details, check the [Microsoft documentation](#).

## 1.2 New features and changes

This Technical State (TS) is a patched one compared to TS 019.02.

It brings a new version of the BIOS firmware which fixes for several issues and security vulnerabilities:

- Security vulnerabilities enhancements against TOCTOU attacks using DMA
- Security vulnerabilities enhancement for Network iSCSI devices
- Security vulnerabilities enhancement in UEFI System Management Mode (SMM) drivers
- Management Engine (ME) SPS firmware update to version SPS\_SoCX\_04.00.04.736.0
- Intel Reference Code update to version RC: 07.D97
- Processor microcode update to version mb750654\_02006f05



---

## Chapter 2. Known issues and restrictions

### 2.1 Platform issues

#### 2.1.1 LDAP authentication

##### Restriction

Configuring LDAP authentication is not yet possible.

#### 2.1.2 Date and time setting

##### Restriction

If the time and date have been set manually, they will be reset to their default values after a BMC reboot.

It is therefore recommended to use an NTP server to set the time and date.

---

**See** BullSequana Edge Server Hardware Console Reference Guide, 86 A1 05FS for more information

---

#### 2.1.3 BIOS firmware update

##### Issue

An error message pops up during the BIOS firmware update:  
Unable to activate image

##### Workaround

Check the firmware version and if it is correct, ignore the error message.

#### 2.1.4 Configuring an IPv4 custom route

##### Restriction

- It is not possible to configure an IPv4 custom route by SSH. Use the Server Hardware Console (SHC) instead.
- It is not possible to configure an IPv4 custom route using the P0 port (eth0). Use the BMC port (eth1) instead:
  - a. Connect the BMC port to the network.

---

**See** BullSequana Edge Description Guide, 86 A1 65FR, for more information on the network ports

---

- b. Select eth1 in the **Network Interface** field of the **IPv4 Settings** area of the SHC **BMC network** settings page.

---

**See** BullSequana Edge Server Hardware Console Reference Guide, 86 A1 05FS, for more information on the BMC network settings page

---

## 2.1.5 Switching from DHCP to static IP address

### Issue

In the **BMC network settings** page of the SHC, when switching from DHCP mode to the Static IP Address, the IP address details entered in the fields are deleted when the **Save Settings** button is clicked. There is therefore a high risk of ending without any IP address at all.

### Workaround

To avoid this issue, click the **Add IPV4 address** button before modifying any information in the fields and only then click the **Save Settings** button.

---

**See** BullSequana Edge Server Hardware Console Reference Guide, 86 A1 05FS, for more information on how to assign a static IP address

---

## 2.1.6 Missing static IP address

### Issue

When the server is connected to the network through the P0 port (eth0) with a DHCP IP address and not through the BMC port (eth1), the default static IP is not visible for the BMC port (eth1) in the SHC **BMC network settings** page.

### Workaround

Connect the BMC port to the network to make the IP address visible in the web page.

---

**See** BullSequana Edge Description Guide, 86 A1 65FR, for more information on the network ports

---

## 2.1.7 Failed memory module

### Restriction

A failed memory module will stop the boot sequence and the host will not start. Replace the failed memory module to allow a successful boot.

## 2.1.8 Power consumption

### Issue

No message is issued in the event log when the power consumption exceeds the power capping limit.

### Workaround

Regularly check PSU power consumption in the sensors.

## 2.2 Software restrictions and issues

### 2.2.1 Installing VMware ESXi using a PXE server

#### Issue

During the installation of VMware ESXi with a PXE server, the sequence hangs just after loading the `vmkusb` VMware driver.

#### Workaround

Disable USB support in the BIOS before the OS installation and enable it again once the installation is done.

### 2.2.2 Hanged BIOS boot

#### Issue

On servers running RHEL, when restarting the server after an Orderly Shutdown/Reboot, the BIOS Configuration menu is inaccessible. The BIOS initialization is suspended at the PchOnEndOfPei stage, but the Operating System (OS) is accessible.

#### Workaround

Flash the BIOS firmware again to go back to normal.

This issue happens because, on servers running RHEL, clicking the **Reboot** or **Shut down** button available in the **Server power operations** page of the SHC does not result in the complete shutdown of the system. For the system to successfully shutdown, the Operating System (OS) must be configured to accept the power off request.

1. In the RHEL Graphical User Interface, go to Applications > System tools > Settings > Power > Suspend & Power Button > When the Power Button is pressed.
2. Choose the Power Off option.



---

## Chapter 3. Recommendations

### 3.1 Technical State (TS) numbering

The numbering of Technical States, TS xy.zz, is done as follows:

- An increase in x indicates that this TS provides new features. It is strongly recommended to install it to benefit from these features. It may also include fixes.
- An increase in y indicates a maintenance TS. It provides a set of fixes and it is recommended to install it. If a problem is reported on a previous TS, it is requested to move to the last such TS first before issuing a ticket.
- An increase in the minor number zz indicates a patched TS that fixes a specific issue. Installing it is not mandatory unless you may encounter this issue or it is declared as a hot fix that may affect most clients.

## 3.2 Updating the system globally to a Technical State (TS)

If MISM is used to update the system globally to a TS, it is strongly recommended to install the newest MISM version first.

## 3.3 Machine Intelligence System Management (MISM)

### 3.3.1 Zabbix version compatibility

MISM is not compatible Zabbix 5 and higher.

### 3.3.2 Installing/Updating MIS M

To update MISM from a version preceding 2.0.2, perform the following steps:

1. Backup the playbooks created by the user.
1. Uninstall any previous versions.
2. Install the new version.

### 3.3.3 Updating firmware from a Technical State (TS) with MIS M

The TechnicalState.iso file must be mounted using one of the following methods:

- from the /mnt root directory before starting containers
- from a /mnt sub-directory. The path to the file must be changed

If the TechnicalState.iso file is mounted after starting the containers, the containers must be restarted.

### 3.3.4 MIS M Light

For MISM Light users, it is strongly recommended to:

- Update to MISM 2.1.3 with `mism_full` before further updates using `mism_light`
- Check the values of the variables in the `external_vars.yaml` file or AWX inventory after adding playbooks

## 3.4 Debugging the system

### Prerequisite

When experiencing any issue with the system, it is strongly recommended to collect the BMC logs. The logs usually contain the information that will help solve the issue.

**See** Section 2.4. Collecting BMC logs of the BullSequana Edge Server Hardware Console Reference Guide, 86 A1 05FS, for the complete procedure.

### Procedure

1. Connect to the Server Hardware Console (SHC).
2. From the Health tab, click Hardware status. The Hardware status page opens.

## Hardware status

All hardware in the system

[Export](#)

FILTER HARDWARE COMPONENTS

Hardware
System
Motherboard
CPU 0
DIMM 0
DIMM 1
DIMM 2
DIMM 3
Fan 0_PCI
Fan 1_CPU
Fan 2_PSU

### Collect BMC logs

Create log file

Download log file

3. Click Create log file.

DIMM 1	<b>Success!</b> Creating log file. <span>×</span>
DIMM 2	
DIMM 3	▼
Fan 0_PCI	▼
Fan 1_CPU	▼
Fan 2_PSU	▼
HDD_0	▼
HDD_1	▼
PCI_0	▼
PCI_1	▼

#### Collect BMC logs

Creating log file...

[Create log file](#)

[Download log file](#)

**Note** This operation may take a long time to complete.

4. Wait for the BMC log file to be created.

CPU 0	<b>Success!</b> Log file is ready to download. <span>×</span>
DIMM 0	
DIMM 1	▼
DIMM 2	▼
DIMM 3	▼
Fan 0_PCI	▼
Fan 1_CPU	▼
Fan 2_PSU	▼

#### Collect BMC logs


[Create log file](#)

[Download log file](#)

5. When the Success message appears, click Download log file



6. Save the archive of the BMC logs, as required.

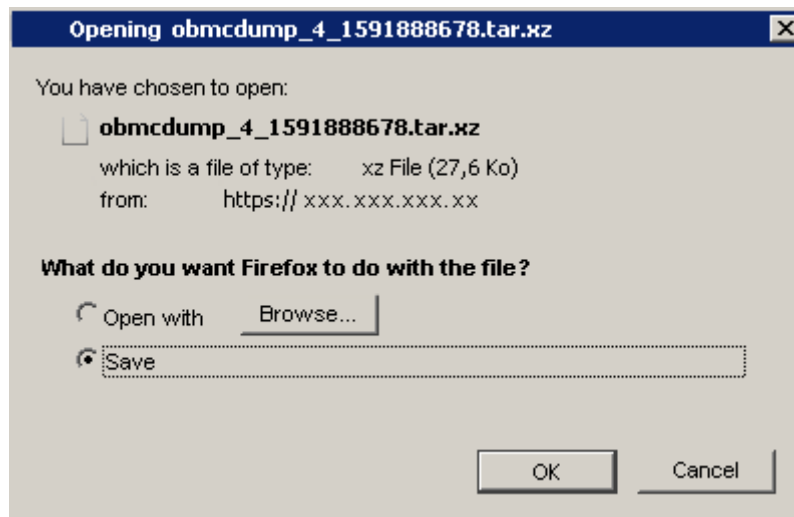



---

## Chapter 4. Information

### 4.1 Baseboard Management Controller (BMC) user accounts

This section applies to systems that are being updated from a TS older than TS 017.02 to TS 017.02 or higher.

The default BMC user admin no longer exists from TS 017.02 onwards. However, effective deletion of this account will only happen after a reset to default factory settings.

#### 4.1.1 First connection to the BMC after the TS update

When connecting to the BMC for the first time after the update of the system, changing the user account password is requested whichever account is being used for the connection.

To avoid changing the password of a custom user account, do one of the following actions:

- If you know the root account password (different from the one indicated in this release note), connect to the BMC using this account and change its password, taking care to record the new account details for subsequent connections.
- If you do not know the root account password (different from the one indicated in this release note), connect to the BMC using the admin account and change its password, taking care to record the new account details for subsequent connections.

---

**Note** A password must be between eight and twenty characters long and contain at least 1 lowercase letter, 1 upper case letter, 1 number and 1 special character.

---

## 4.1.2

### First connection to the BMC after a reset to default settings

When connecting to the BMC for the first time after a reset to default factory settings, proceed as follows:

1. Use the following default user parameters.

BMC default user	
Username	root
Password	At0s !Edge

2. Change the default user password once initial setup is completed, taking care to record the new account details for subsequent connections.

- 
- Notes**
- A password must be between eight and twenty characters long and contain at least 1 lowercase letter, 1 upper case letter, 1 number and 1 special character.
  - If a reset to default factory settings is performed, the root user password will be switched back to its default value and will have to be changed again.
-

---

## Chapter 5. Delivery contents

### 5.1 Delivered items

- Documentation and firmware are delivered on the Resource and Documentation DVD
- Machine Intelligence System Management (MISM) is delivered on the Bull support website: <http://support.bull.com>

- 
- Notes**
- A new product row is highlighted in grey
  - A new version is highlighted in grey
- 

### 5.2 Documentation

Name	Description	Version
BullSequana Edge Customer Documentation Set	Complete documentation dedicated to the customer	09
BullSequana Edge Field Documentation Set	Complete documentation dedicated to the field	09

### 5.3 Platform firmware

Name	Description	Version
BIOS_SKD080	BIOS firmware	80.29.00 build 000
CPLD_MIPCS	Flash image for the CPLD component	4.3.0.0
Lora_Soft_Kit	Toolkit for using the LoRa Wireless Communication Module	1.0
OMF_MIPCS	Server Hardware Console (SHC) firmware	69.00 build 0824
VR_PCH_CPU0_MIPCS	Configuration file for processor voltage regulator on the motherboard	1.0.0
VR_PVCCIN_CPU0_MIPCS	Configuration file for processor voltage regulator on the motherboard	1.0.0
VR_PVCCIO_CPU0_MIPCS	Configuration file for processor voltage regulator on the motherboard	1.0.0

VR_PVDDQ_AB_CPU0_MI PCS	Configuration file for processor voltage regulator on the motherboard	1.0.0
VR_PVDDQ_DE_CPU0_MI PCS	Configuration file for processor voltage regulator on the motherboard	1.0.0

## 5.4 Administration tools

Name	Description	Version
MISM	A web application used for hardware maintenance	2.1.9

---

## Chapter 6. History of previous versions

### 6.1 TS 019.02 (July 2022)

#### New features and changes

##### BIOS\_SDK080

- UEFI security vulnerabilities update
- Management Engine (ME) SPS firmware update to version SPS\_SoC-X\_04.00.04.500

#### Resolved issues

- **Sensor values**

The sensors values obtained by IPMI commands are now coherent.

- **Request to change a user password**

When connecting to the BMC for the first time after the update of the system, changing the user account password is now only requested if the account used is the root account and if its password is still the default password.

- **Incorrect message after TS update**

The following message no longer appears in the BMC event log after updating to TS 019.02:

BMC booted from backup flash. Only limited operations allowed.

## 6.2 TS 018.03 (February 2022)

### New features and changes

This Technical State 018.03 is a patched one compared to Technical State 018.02. It provides important fixes and contains a new release of the BMC firmware.

### Resolved issues

- **BIOS firmware update**

In the Firmware page of the SHC, the pop-up window displaying the error message 'Unable to activate image' no longer appears at the end of a successful BIOS firmware update.

- **The NVIDIA A2 GPU card is not recognized as a GPU card**

The NVIDIA A2 GPU card is now correctly detected as a GPU card and no longer as a standard PCI card.

- **The XAN information is lost after a reset**

When connecting to the BMC after a reset, the XAN information now remains visible.



## 6.3 TS 018.02 (November 2021)

### New features and changes

#### OMF\_MIPCS

- Merge with OpenBMC 2.9. Correction of the OpenBMC vulnerability on crafted IPMI messages is included
- Update fan control algorithm

#### MISM

- Warning: start / stop scripts from dockerhub separated
- Update\_from\_atos\_dockerhub.sh script shell to update versions

### Resolved issues

#### Collecting BMC logs

It is no longer necessary to manually delete the oldest log files when the maximum number of log files that can be stored is reached.

When the maximum number of log files is reached, all log files are deleted.

## 6.4 TS 017.02 (June 2021)

### New features and changes

#### OMF\_MIPCS

- The default password of the root account has been changed. It is now At0s!Edge.
- After a reset to factory settings and first login, the user is asked to change the password for the root account
- The admin account has been removed
- SSH is now deactivated

### Resolved issues

- **Intrusion status**

It is now possible to clear the intrusion status in the Chassis intrusion page of the SHC.

- **Baseboard Management Controller (BMC) firmware update**

During the update of the BMC firmware via the SHC or MISM, the message indicating the failure to upload the file is no longer displayed.

This issue was fixed by TS 016.02 and will not be encountered during the update of the system to TS 017.02.

- **BIOS and CPLD firmware update**

After the update of the BIOS or CPLD firmware, the firmware no longer stays in active mode when it should be in functional mode.

- **Failed BIOS firmware update**

After the BIOS firmware update, the error message Unable to activate image is no longer displayed in the SHC Firmware page when the update is indicated as successful in the event log.

- **Baseboard Management Controller (BMC) SSL certificate**

The unexpected certificate error, preventing the curl commands from running, no longer appears in the event log.

## 6.5 TS 016.02 (January 2022)

### New features and changes

#### BIOS\_SKD080

- Send TPM status to EMM
- Update Gbe X722 PXE driver to 4.3.05

#### CPLD\_MIPCS

Factory reset detection logic

#### OMF\_MIPCS

OpenBMC 2.8 merged code and associated features

#### LORA\_SOFT\_KIT

- First official release
- Support RedHat 7 distribution
- Support RedHat 8 distribution

#### MISM

- There are two separate deliverables for MISM:
  - MISM\_full for full installation
  - MISM\_light for light installation or update, which contains only AWX playbooks, AWX plugins, Zabbix templates, Zabbix external scripts and shell scripts
- MISM is delivered with a backup and a restore script for AWX and Zabbix databases
- The installation of Python tzlocal is optional: date will have no time localization indication (+02, -01...) if not installed

### Resolved issues

- **Server Hardware Console (SHC) user accounts**

It is now possible to create user accounts with different access rights.

- **Intrusion detection**

False intrusion detections no longer appear in the Intrusion Detection page of the SHC and in the event logs.

- **Cold or Warm Reboot**

The Immediate Reboot (formerly Cold reboot) or Orderly Reboot (formerly Warm reboot) buttons in the Server power operations page of the SHC function now correctly.

## 6.6 TS 015.02 (August 2020)

### New features and changes

#### BIOS\_SKD080

- Fix for Automatic failover booting feature
- Reference Code version RC 06.D51
- Fixes for Windows Server 2019 certification for Secure Boot and memory options (one DIMM set per channel, unused channels set disabled)

#### OMF\_MIPCS

- Adding network routes feature
- Log collect feature

### Resolved issues

- **Connection to the BMC in Zeroconf mode**  
Connection to the Baseboard Management Controller (BMC) in Zeroconf mode using the BMC port is now possible.
- **BIOS firmware version file**  
The BIOS version file is now correctly generated after a firmware update.
- **BMC reboot on a powered off host**  
Rebooting the BMC on a powered off host does not automatically restart the host anymore.
- **Automatic boot to PXE interfaces**  
The automatic boot runs correctly, without requiring human intervention anymore.
- **Visibility of the host serial number in the BIOS**  
The host serial number is now visible in the BIOS when it is accessed via a guest Operating System (OS).

## 6.7 TS 014.01 (May 2020)

### New features and changes

#### BIOS\_SKD080

- Generate signed BIOS image
- Reference Code version RC 06.D34
- Updated Intel Xeon Skylake-D processor microcode to version 02000065
- Updated the Management Engine (ME) SPS firmware to version SPS\_ SoC-X\_04.00.04.112
- Detect chassis intrusion in standby, during boot and in runtime and take actions based on BMC settings

#### MISM

- New Zabbix template for BullSequana Edge Host
- New Zabbix template for BullSequana Edge Map
- BullSequana Edge Zabbix Icons
- Added two missing sensors as items and their associated graph in Zabbix
  - Power psu-iout (Amperes)
  - Total power (Watts)
- Prerequisites helping script with NO warranty

#### OMF\_MIPCS

- IPMI Out Of Band support
- Signed firmware support for BIOS, BMC and CPLD firmware

### Resolved issues

- **Sensor display in Idle or Off state**  
Sensor display values are now correctly implemented for systems in Idle or Off state.
- **Date and hour settings in the Server Hardware Console (SHC)**  
Manually setting the date and hour is now possible from the SHC.
- **Powering the server off**  
Powering off the server using the Power button is now possible.
- **Encrypted passwords**  
Password encryption in the controlling console (Ansible Tower) is now fully implemented and no longer hinders job launches.

## 6.8 TS 006.02 (December 2019)

### New features and changes

#### BIOS\_SKD080

- Print BMC and CPLD Version in BIOS log
- Chassis intrusion detection (Note: if chassis is open, the system will not boot)

#### OMF\_MIPCS

New user 'admin' has been created.

After the update of the BMC firmware to the version provided in this TS, it is necessary to run the following commands in ssh so that the new user information is taken into account:

3. Export the BMC credentials using the following command:

```
export bmc=<user>:<pwd>@<BMC IP>
```

4. Perform the reset to default factory settings of the BMC using the following command:

```
curl -b cjar -k -H 'Content-Type: application/json' -X POST -d '{"data":[]}' https://${bmc}/xyz/openbmc_project/software/action/Reset
```

#### MISM

- Full installation through install.sh and start/stop.sh scripts
- Zabbix monitoring

### Resolved issues

- **KVM interface in the Server Hardware Console (SHC)**

Using the Refresh button no longer makes the Keyboard Video Mouse page unavailable.

- **Wireless connection configuration**

Configuring LTE or WiFi for BMC is now possible through the SHC.

- **BMC WiFi connection**

The user is now warned that the entered password is incorrect and the connection unsuccessful.

- **BMC WiFi connection after a BMC reboot**

Connection to the BMC WiFi is now automatically restored after rebooting the BMC.

## 6.9 TS 005.01 (September 2019)

### New features and changes

#### BIOS\_SKD080

- New Bakerville Code Drop 14
- Support for sending memory module and PCIe errors to the Server Hardware Console (SHC)
- Update to SMBIOS Type 0/1 Information
- Send processor microcode version information to the SHC
- Send processor SKU number, PCH information, processor signature and number of enabled cores to the SHC

#### OMF\_MIPCS

Identification of failing components including physical position

#### MISM

- MIPM renames as MISM
- start/stop/uninstall/remove\_user\_data scripts
- add\_playbooks separate script to allow light delivery after first install

### Resolved issues

#### Server Hardware Console (SHC) user accounts

Creating a new user account in the SHC web interface is now possible.

## 6.10 TS 004.01 (June 2019)

First delivery





**Bull Cedoc**  
**357 avenue Patton**  
**BP 20845**  
**49008 Angers Cedex 01**  
**FRANCE**